

Clutch Pedal Squeak/Creak Noise

Service Category Drivetrain

Section Clutch

Market USA

Toyota Supports
 ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2005 – 2012	Tacoma	Transmission(s): 5MT, 6MT

SUPERSESSON NOTICE

The information contained in this bulletin supersedes SB No. TC004-06.

- **Applicability has been updated to include 2007 – 2012 model year Tacoma vehicles.**
- **Repair Procedure has been updated.**

Service Bulletin No. TC004-06 is Obsolete and any printed versions should be discarded. Be sure to review the entire content of this bulletin before proceeding.

Introduction

Some 2005 – 2012 model year Tacoma vehicles may exhibit a squeak or creak noise from the clutch pedal when it is depressed or released. Changes have been made to the clutch pedal and clutch master cylinder assembly to address this condition.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	DRIVETRAIN	ENGINE	PRODUCTION CHANGE EFFECTIVE VIN
Tacoma	2WD	2TR-FE	5TFNX4CN#CX013530
			5TFTX4CN#CX017059
		1GR-FE	5TFTU4CN#CX001419
	4WD	2TR-FE	5TFPX4EN#CX010542
			5TFUX4EN#CX013317
		1GR-FE	5TFUU4EN#CX037545
			5TFLU4EN#CX037544

Clutch Pedal Squeak/Creak Noise

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
313011	R & R Clutch Pedal Sub-assembly and Clutch Master Cylinder Assembly	1.1	31311-04011	91	84

APPLICABLE WARRANTY

- This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
31420-04010 31420-04011	31420-04020	Clutch Master Cylinder Assembly	1
31311-04010 31311-04011	31311-04012	Clutch Pedal Sub-assembly	1

Required Tools & Equipment

REQUIRED MATERIAL	QUANTITY
MP (Multi-Purpose) Grease	As Needed
Brake Fluid: SAE J1703 or FMVSS No. 116 DOT 3	As Needed

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Union Nut Wrench 10 mm	<u>09023-00101</u>	1

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

Clutch Pedal Squeak/Creak Noise

Repair Procedure

1. Confirm there is a squeak or creak noise from the clutch pedal assembly when it is depressed or released.

Is the noise coming from the clutch pedal assembly?

- **YES** — Go to step 2.
- **NO** — This bulletin does NOT apply. Refer to the applicable Repair Manual for diagnosis.

NOTE


Be sure the noise is from the clutch pedal assembly, and not from other components related to the clutch system.

2. Replace the clutch pedal and clutch master cylinder assembly.

NOTE

Be sure to apply MP Grease where the clutch master cylinder clevis and clutch pedal meet in addition to the locations identified in the Repair Manual (See Figure 1.)

Figure 1.

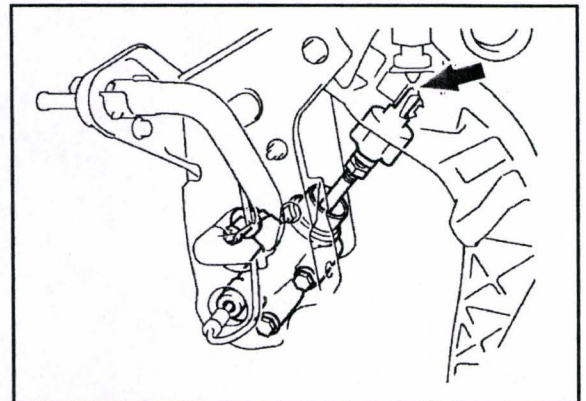

Refer to the Technical Information System (TIS), applicable model year Tacoma Repair Manual:

- 2005 Tacoma:
Drivetrain – Clutch – “Clutch Pedal Sub-Assy: Replacement”
- 2006 – 2012 Tacoma:
Drivetrain – Clutch – “Clutch: Clutch Pedal: Removal/Installation”
 - 2006 Tacoma: *Removal / Installation*
 - 2007 Tacoma: *Removal / Installation*
 - 2008 Tacoma: *Removal / Installation*
 - 2009 Tacoma: *Removal / Installation*
 - 2010 Tacoma: *Removal / Installation*
 - 2011 Tacoma: *Removal / Installation*
 - 2012 Tacoma: *Removal / Installation*

3. Confirm the repair.